

# MONUMENT RECORD


Corner I.D. #

S-7

STATE OF INDIANA - COUNTY OF MONROE

Section Eleven (11), Township 10 North, Range 1 West

**Monument Description & Remarks:** Stone found at Center of Section. Weathered sandstone w/remnants of "X" visible; 4" x 4"; 2" exposed. Steel fence post driven next to stone. Corner witnessed 3/16/89.

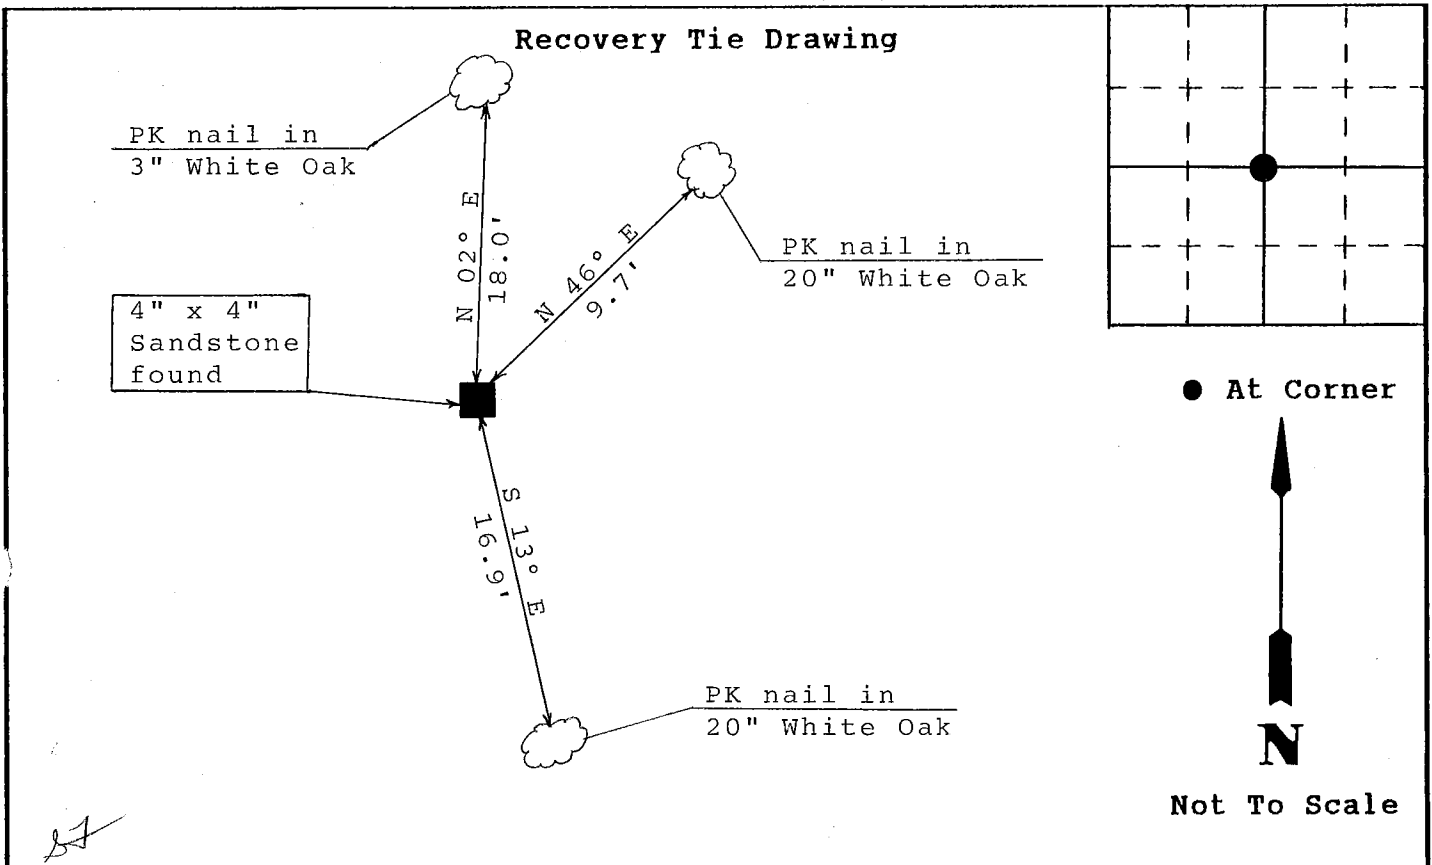

State of Indiana  
County of Monroe

Space  
Reserved For  
Recording  
Officer

I, Michael W. Friley, County Surveyor, hereby certify that this document was prepared under my direction in accordance with the provisions of Section 17-3-64-4 through 17-3-64-8 of the Indiana Code, being Acts of 1965, Chapter 319; and the above data is given under my hand and seal this 2nd day of November, 1993 A.D.

Indiana Registered Land Surveyor No. \_\_\_\_\_ or

Morgan-Monroe State Forest

**United States Government Agency**

David C. Vadas, Timber Specialist

**Title**

**Field Book:**

n/a

**Page:**

n/a

## SECTION 11, T 10 N, R 1 W

1. On Sept. 23, 1982, the following boundary lines were located and marked with orange tree marking paint on the state owned side: the north EW line of S $\frac{1}{2}$ , SW $\frac{1}{4}$ ; the NS and south EW lines of SE $\frac{1}{4}$ , SW $\frac{1}{4}$ . Surveyors monuments were located as follows: steel pipe--NE corner of SE $\frac{1}{4}$ , SW $\frac{1}{4}$ ; steel pipe--SW corner of SE $\frac{1}{4}$ , SW $\frac{1}{4}$ . A tree with fence wire protruding in two directions was selected as the NW corner of SW $\frac{1}{4}$ , SW $\frac{1}{4}$ . <sup>(see 4f)</sup> The north EW line of S $\frac{1}{2}$ , SW $\frac{1}{4}$  was established by adjusting from magnetic EW so that the line passes through the described corners. Signs were also posted.

*(Signature)*

Darrell Breedlove, Timber Specialist

2. On January 21, 1988 Tom Fisher and I repainted and posted the following lines: The S & E line of the SE $\frac{1}{4}$ , SW $\frac{1}{4}$ , Sec. 11.

David C. Vadas Timber Specialist

3. On January 22, 1988 Rick Followell and Tom Fisher repainted and posted the N line of the S $\frac{1}{2}$  of the SW $\frac{1}{4}$ , Sec. 11.

David C. Vadas Timber Specialist

4. On March 16, 1989, the following boundary work was concluded (work began in Dec. '88).

a.) The east half-mile stone (SE corner of N $\frac{1}{2}$ ) was located. This low stone has a faint "x", a long piece of pipe stuck loosely next to it, and old witness blazes on two hickories. It was witnessed using galvanized nails as follows:

Az	Species	DBH(in.)	Distance(ft.)	Comment
014	Pignut Hickory	13	7.1	4 blazes
158	Pignut Hickory	15	12.7	4 blazes
347	Sugar Maple	8	10.8	

A steel fence post was driven next to the 4"x6" granite stone. This stone was found to be S 1.4° E (1° W dec.) of the NE section corner.

b.) The center section stone was located. This sandstone marker is weathered, but it still has remnants of its "x" visible on the edges of the 4"x4" top surface. It is about 2" high. It was witnessed using PK nails as follows:

Az	Species	DBH(in.)	Distance(ft.)	Comment
046	White Oak	20	9.7	
002	White Oak	3	18.0	has old metal sign
167	White Oak	20	16.9	hollow tree

A steel fence post was driven next to the stone. This stone was found to be N 87° W (1° W) from the east  $\frac{1}{2}$ -mile stone. Fence wire was found on-line, mid-way between the two stones.

*Pink Pins,  
Tap. Filed*

*draw*

*draw*

*S 13° E*